

*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This late-19th-century, 3-bay, 2-story, hip-roofed frame I-house features projecting 1-story polygonal bays on either side of the central entrance. The house rests on a raised parged foundation and has a standing-seam metal roof, and asbestos shingle siding. The windows, which have been replaced include 2/2-sash and single and paired 1/1 sash. This large house has overhanging eaves and a 1-bay front porch with square posts and a 3-rail balustrade. The front porch and side bays feature Mansard roofs of standing-seam metal. A 1-story wing extends to the rear.



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This late-19th-century, 3-bay, 2-story frame I-house features a central-front gable, a brick foundation, asbestos siding, and a standing-seam metal hipped roof. The 2/2-sash windows are replacements, but the central brick chimney, pedimented front gable with round attic vent, overhanging eaves, and 2-light transom above the front door appear original. The 5-bay, hip-roofed front porch features turned spindles, sawn brackets, and a plain balustrade. The second-story, central-bay window on the façade features a paired 2/2 sash. The house features a rear 2-story hip-roofed ell with side and rear additions.



*Primary Resource Information:* **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls have been stuccoed and the roof is covered in modern standing-seam metal with ridge vents. The 1/1 windows are replacements but the transom over the door, exterior parged brick chimney on the rear wall, and overhanging eaves are original. The 4-bay wraparound porch, supported by Tuscan columns, has plain pickets and wraps around the north side of the house to join the front section to a side/rear 2-story wing that contains a door out onto the porch. The house has a 1-story, hip-roofed rear and side wing with side porch.



*Primary Resource Information:* **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls are clad in vinyl siding but the roof maintains its standing-seam metal covering. The 2/2-sash windows, 3-light transom and 3-light sidelights around the door, interior brick chimney with corbelled cap, and overhanging eaves are original. The 7-bay wraparound porch, supported by chamfered posts, has sawn brackets, a sawn balustrade, and is supported by a brick pier foundation with lattice infill. The house has a 1-story, gable-roofed side wing with enclosed front porch that is set back from the front section. A shed-roofed bay is located along the side of the main block and may provide access to a crawl space.



*Primary Resource Information:* **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls are clad in vinyl siding and the roof in asphalt shingles. The 1/1 windows are modern but the 2-light transom over the door, exterior parged brick chimney on the rear wall, and overhanging eaves are original. A second-story opening on the north side has closed shutters and may be a blind window. The 4-bay wraparound porch is supported by chamfered posts with sawn brackets and a sawn balustrade and wraps around the north side of the house to join the front section to a side/rear 1-story wing that contains a door out onto the porch. The house has a 1-story, gable-roofed rear wing with numerous side lean-to additions.



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, frame dwelling features a hipped roof with cross gables. The walls are clad in aluminum siding and the roof in asphalt shingles. Constructed ca. 1900, the house has a central parged flue, a brick foundation, 2/2-sash wood windows, overhanging eaves, a plain friezeboard, and gable end returns. A 1-story shed-roofed wing extends off the north side. The 2-bay, hip-roofed front porch has turned posts, sawn brackets and plain pickets.



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, side-passage-plan frame dwelling features a hipped roof with a front cross gable. Constructed ca. 1890, the house has an exterior brick chimney on the rear wall, a standing-seam metal roof, vinyl siding, vinyl shutters, 2/2-sash wood windows, and a transom and sidelights around the front door. A 6-bay wrap around porch is supported by Tuscan columns and has turned balusters and a denticulated cornice. A 1-story, gable-roofed frame wing extends to the rear and features a side porch with sawn balustrade.

*Individual Resource Status:* **Single Dwelling** Contributing *Total:*1 *Individual Resource Status:* **Shed** Contributing *Total:*1



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling was constructed during the late 19th century. The walls are clad in vinyl siding but the roof is covered in standing-seam metal and the house maintains original 2/2-sash windows, a transom over the door, a central brick chimney, and overhanging eaves. The 6-bay wraparound porch is supported by Tuscan columns and wraps around the north side of the house to join the front section to a rear wing that contains a door out onto the porch. The house has a 2-story rear wing on a raised basement and an attached shed-roofed garage wing on the south side.

*Individual Resource Status:* Single Dwelling Contributing *Total:*1 *Individual Resource Status:* Single Dwelling Non-Contributing *Total:*1



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1895** July 2006: This late-19th-century, 3-bay, 2-story frame I-house features a central-front gable, a brick foundation, weatherboard siding, and an asphalt-shingled gabled roof. The 2/2-sash windows are replacements, but the two central brick chimneys, central-front gable with round attic vent, overhanging eaves, plain frieze, and 3-light transom and sidelights around the front door appear original. The 5-bay, hip-roofed front porch features Tuscan columns and a plain balustrade. A 1-story wing extends to the rear.

1

Individual Resource Status:	Single D	welling Contri	buting	Total:
Individual Resource Status:	Shed	Contributing	Total:	1
Individual Resource Status:	Garage	Contributing	Total:	1



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1915** July 2006: This 2-story, 2-bay, hip-roofed vernacular brick side-passage-plan house was constructed ca. 1915. The brick walls are laid in 6-course American bond brick and a plain brick frieze that is painted white runs along the top of the walls. The house has 2/2sash windows, a transom over the door, a brick foundation, a central interior brick chimney, and overhanging eaves. The roof is covered in standing seam-metal. The 3-bay hip-roofed front porch has Tuscan column supports and turned balusters. A 1-story brick wing extends to the rear with a second-story frame addition and side 2-story frame wing to the wing.



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1910** July 2006: This 2-story, 2-bay, hip-roofed vernacular side-passage-plan house was constructed ca. 1915. The walls are covered in stucco and have a plain frieze beneath the overhanging eaves of the hipped roof that is clad in asphalt shingles. The house has 2/2-sash windows, and a 3-bay hip-roofed front porch with Tuscan column supports and plain pickets. A 1-story brick wing extends to the rear.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1890 July 2006: This late-19th-century, 2-story, 2-bay, vernacular side-passage-plan dwelling has a very tall, pedimented, gable-end front with paired attic windows. The house has stuccoed walls and an asphalt-shingled cross-gabled roof. The house has a plain frieze, 2/2-sash windows, gable-end returns, a 3-light transom and sidelights around the door, and a 3-bay front porch with Tuscan columns and plain pickets. A 2-story wing extends off the rear 2-story ell. The roof on this house may have been altered to its current configuration as it seems slightly out of proportion with the dimensions of the house.



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1900 July 2006: This 2-story, 3-bay, frame dwelling features a hipped roof with cross gables. It was originally a side-passage-plan, 2-bay wide building, but an extra front door has been added, converting it into a duplex. Other alterations include a roof clad in asphalt shingles and walls covered in vinyl siding. Constructed ca. 1900, the house has a central interior brick chimney, a parged foundation, modern vinyl 2/2 windows, overhanging eaves, a plain friezeboard, and gable end returns. A 2-story wing on a concrete block foundation extends off the rear ell. The 3-bay, hip-roofed front porch has square supports. *Individual Resource Status:* Single Dwelling Contributing *Total:* 1



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 3-bay, frame dwelling features a hipped roof with cross gables. It was originally a side-passage-plan, 2-bay wide building, but an extra front door has been added, converting it into a duplex. Other alterations include a roof clad in asphalt shingles and walls covered in vinyl siding. Constructed ca. 1900, the house has a central interior brick chimney, a brick foundation, modern 1/1 windows, overhanging eaves, plain friezeboard, and gable end returns. The cross gables still retain pressed tin shingles in the gable ends as well as a round wooden attic vent. A 2-story wing extends off the rear ell. The 3-bay front porch has square supports and appears to have been screened at one time.



*Primary Resource Information:* **Single Dwelling, Stories 2.00, Style: Other, ca 1890** July 2006: This turn-of-the-century, 2-story, 2-bay vernacular frame dwelling is currently under renovation. It is a single-pile, side-passage plan and is clad in weatherboard siding although vinyl siding is currently being installed. The hipped roof is covered with asphalt shingles and has overhanging eaves, a plain frieze, and an exterior brick chimney along the rear elevation. Some of the original 2/2-sash windows are still visible although most have been replaced with modern 1/1-sash. A 1-story, gable-roofed frame wing extends to the rear and has original weatherboard siding, gable-end returns, and a side-lean to wing. The front 4-bay porch has square posts on wood piers and a modern balustrade. It extends one bay south of the main block to take in part of a side 1-story, 1-bay wing.



*Primary Resource Information:* Single Dwelling, Stories 2.00, Style: Late Victorian, ca 1897

July 2006: Constructed in 1897, this 2-story, 3-bay, brick, vernacular I-house features some Victorian decorative elements. The hip-roofed house has a standing-seam metal roof and the brick walls are laid in a 6-course-American-bond pattern. The house has not been greatly altered and includes: 2/2-sash wood windows with wooden sills and molded surrounds, a double-leaf, wood and glass front door comprised of a tall pane of glass surrounded by small panes of stained glass; a 2-light transom above the doors; a plain brick frieze; two central interior brick chimneys with corbelled caps; a round stained-glass window on the second-floor, center bay of the rear elevation; and a 1-story, hip-roofed, rear brick wing with two interior chimneys and a plain brick frieze. The 3-bay, hip-roofed front porch has turned posts, a wooden floor, and no balustrade.

*Individual Resource Status:* **Single Dwelling** Contributing *Total:* 1 *Individual Resource Status:* **Shed** Contributing *Total:* 1



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1925

July 2006: Constructed ca. 1925, this 1 <sup>1</sup>/<sub>2</sub>-story, 3-bay, gable-end, brick dwelling is a vernacular interpretation of the Craftsman Bungalow style. The walls are laid in stretcher bond brick, the roof is clad in asphalt shingles, and the house contains exposed rafter ends, overhanging eaves, and 1/1-sash windows. The 1-bay, integral, full-span, front porch has a pedimented gable end containing asphalt shingles and a round wooden attic vent. The porch, supported by square posts located at the outer corners, has a brick floor.

# **420** 7<sup>1</sup>/<sub>2</sub> **Street SW 104-0220** *Other DHR Id #:* **104-0213-0055**



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Colonial Revival, ca 1910

July 2006: This 2-story, 3-bay, double-pile, hip-roofed vernacular brick dwelling appears to have been constructed ca. 1910 and contains architectural elements of the Colonial Revival style. The walls are laid in 5-course American bond, which is rare for a post-bellum building and is usually seen on ones from the first half of the 19th century. The roof is clad in asphalt shingles and there is no evidence of a chimney. A plain brick frieze that has been painted white is protected by the overhanging eaves. The 1/1-sash windows appear to be modern replacements. The front door has a transom above whereas the sidelights have been enclosed. A 3-bay, hip-roofed front porch has square brick posts on brick piers and a low brick wall. A side 1-story, 1-bay, gable-roofed, brick ell extends to the south.

Individual Resource Status:Single DwellingContributingTotal:1Individual Resource Status:ShedContributingTotal:1

### **501** 7<sup>1</sup>/<sub>2</sub> **Street SW 104-0223** *Other DHR Id #:* **104-0213-0060**



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1915** July 2006: This 2-story, 2-bay, double-pile, hip-roofed vernacular brick dwelling appears to have been constructed ca. 1915. The brick walls are laid in stretcher bond and the 2bay façade features off-center openings. The hipped roof is clad in standing-seam metal and contains an interior brick chimney. Other details include overhanging eaves, a boxed cornice, 2/2-sash windows, a 3-bay hip-roofed front porch with tapered square posts on wooden piers, and a rear gable-roofed screened-in porch.

509 7<sup>1</sup>/<sub>2</sub> Street SW 104-0213-0061



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 3-bay, hip-roofed vernacular brick I-house was constructed ca. 1900. The brick walls are laid in 6-course American bond brick and the 2/2-sash windows have brick segmental arches on the first floor. The double-leaf, wood and glass front door has a 3-light transom. Other details include a plain brick frieze, two central interior brick chimneys with corbelled caps, a split–level foundation, and 2-story rear addition flanked by 1-story wings. The 3-bay, gable-roofed front porch has square posts on low piers and a segmental arch in the pediment.



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, frame, hip-roofed vernacular dwelling rests on a brick foundation. Constructed ca. 1900, it is two bays wide on the first floor and one-bay wide at the second, with the window opening on the second floor directly above the window on the first floor. The hipped roof is clad in asphalt shingles with no visible chimney, and the double-hung wood windows have 6/6-sash. The house features overhanging eaves, a split-level foundation, a 2-bay hip-roofed front porch with turned posts and plain pickets, and rear 1-story shed-roofed wing.

Individual Resource Status: Single Dwelling

Contributing Total: 1



Primary Resource Information: Multiple dwelling, Stories 2.00, Style: Other, ca 1900

July 2006: This 2-story, 4-bay, gable-roofed vernacular I-house features two front doors and may have been constructed as a duplex. The house, clad in weatherboard siding, has a gabled roof with a central-front gable that is covered in standing-seam metal. An exterior brick chimney is located on the south gable end while an interior brick flue is located on the north gable end. Other details include a parged foundation, 6/6-sash windows, gable-end returns, a plain friezeboard, corner boards, 6/6-sash windows, and a rear 1-story hip-roofed wing with central brick chimney. The 3-bay, front porch has chamfered posts and a low Mansard roof.

Individual Resource Status: Multiple dwelling Con

Contributing Total: 1



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: Constructed ca. 1890, this 2-story, 2-bay, cross-gabled, vernacular frame dwelling is clad in weatherboard siding and has a standing-seam metal roof. Other details include plain frieze board, overhanging eaves, corner boards, stone foundation, and round attic vent in the gable ends. The 1/1-sash vinyl windows, louvered vinyl shutters, and steel front door are modern alterations.



Primary Resource Information: Single Dwelling, Stories 1.50, Style: Bungalow/Craftsman, ca 1925

July 2006: This 1<sup>1</sup>/<sub>2</sub>-story, 3-bay, frame bungalow has a gable roof with a large gabled front dormer with weatherboard siding and three windows. Constructed ca. 1930, the house features a split level concrete foundation, bricktex siding, asphalt shingle roofing, interior brick chimney, overhanging eaves with exposed rafter and purlin ends, 4/1 windows, and a 3-bay gabled porch with battered wood columns on brick piers.



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1900** July 2006: This 2-story, 2-bay, hip and cross-gable-roofed, side-passage-plan, frame dwelling features a hipped roof with cross gables and was constructed ca. 1890. The house rests on a brick foundation and features a central brick chimney, standing-seam metal roofing, weatherboard siding, 1/1-sash windows, a plain frieze, wood shingles and round attic vents in the gable end, gable-end returns, a double-leaf front door with single-light transom, and a rear 1-story hip-roofed wing. The 5-bay wraparound front porch features turned spindles, turned balusters, sawn brackets, and a Mansard roof.




Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1885 July 2006: This 2-story, 2-bay, cross-gabled, frame vernacular dwelling with many Victorian details was constructed in 1885 by Jacob H. Nalls, a local building contractor. Clad in vinyl siding over the original German-lap siding, which is visible under the front porch, the house has a roof of standing seam metal. The house features a projecting front bay under the front porch and a projecting rectangular bay off the rear ell. Resting on a brick foundation, the house has interior brick chimneys with corbelled caps. The 2/2-sash vinyl windows are modern replacements. The 6-bay front porch, supported by turned posts, has segmental-arched bays that are formed by the double pierced two-stage frieze with Eastlake-style detailing. The bays of the porch around the bay window make a semioctagonal projection around the bay window. A small second-story gabled pavilion that appears to be a later addition is set on the roof of the porch over the entrance bay. Other details include pressed tin shingles in the front pedimented gable end, a plain bracketed frieze, and a modern front door. The rear 2-story wing has enclosed side porches and a rear 1-story lean to. The house is now used as offices for Dogwood Housing Ltd., who purchased the property in 1980.

*Individual Resource Status:* Single Dwelling Contributing *Total:* 1 *Individual Resource Status:* Single Dwelling Non-Contributing *Total:* 1



*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1890** July 2006: This 2-story, 2-bay, hip and cross-gable-roofed, side-passage-plan, frame dwelling features a hipped roof with cross gables and was constructed ca. 1890. The house rests on a parged brick foundation and features a central parged chimney, asphalt shingle roofing, aluminum siding, 1/1-sash windows, a plain frieze, gable-end returns, a 2-story rear wing and a rear 1-story gable-roofed wing with enclosed side porch. The 3-bay, hip-roofed front porch is supported by square posts.

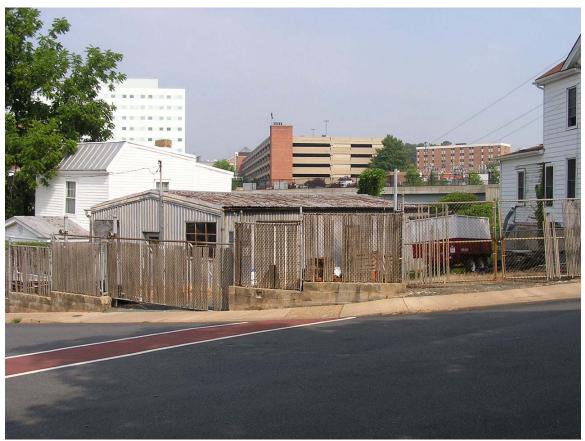

*Primary Resource Information*: Warehouse, Stories 1.00, Style: Other, ca 1940 July 2006: This 1-story, 3-bay, gable-end, frame storage building is clad in corrugated metal roofing and siding and contains a garage door and steel 9-light windows. It appears to have been constructed ca. 1940 on the site of the former Fife Chapel.

Individual Resource Status: Warehouse Contributing Total: 1



Primary Resource Information: Multiple dwelling, Stories 3.00, Style: Other, ca 1991

July 2006: This 3-story, modern vernacular, brick building with 3 front-facing cross gables was constructed in 1991 and is the Ronald McDonald House, a place where parents of children that are in a hospital can stay at night. It is constructed on the site of the Moore-Wingfield House, a fine Victorian dwelling constructed in 1885.

Individual Resource Status: Multiple dwelling Non-Contributing otal: 1



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Other, ca 1886 July 2006: This 2-story, 2-bay, gable-end, vernacular frame dwelling was constructed ca. 1886 by Mrs. Lena King. The house rests on a brick foundation and has weatherboard siding and a standing-seam metal roof. Architectural details include gable-end returns, plain friezeboard, corner boards, a rectangular attic vent, 3-light transom, and a 1-story, 1-bay, hip-roofed side wing that extends past the rear of the main block of the house. Modern 1/1-sash windows replaced the original 6/6-sash. The 3-bay hip-roofed front porch has turned posts and plain pickets and incorporates a modern handicap ramp.

*Primary Resource Information*: **Single Dwelling**, **Stories 2.00**, **Style: Other, ca 1925** July 2006: This 2-story, 2-bay, hip-roofed, vernacular frame dwelling appears to have been constructed ca. 1925. It is clad in aluminum siding, rests on a brick foundation, and has a standing–seam metal roof. Architectural details include a central brick chimney, split-level foundation, overhanging eaves, exposed rafter ends, 6/1- and 6/6-sash windows, a single transom over the 6-paneled door, and a 3-bay hip-roofed front porch with battered square posts and exposed rafter ends. To the rear is a 1-story porch and modern 2-story decks.



Primary Resource Information: Commercial Building, Stories 1.00, Style: Other, ca 1969

July 2006: This 1-story, cross-gabled, 5-bay, brick, vernacular commercial building was constructed in 1969. The building rests on a concrete foundation with stretcher-bond brick walls, and has an asphalt shingle roof, multiple garage doors, and vinyl siding in the gable ends.

Individual Resource Status: Commercial Building Non-Contributing Total:1



Primary Resource Information: Commercial Building, Stories 1.00, Style: Other, ca 1950

July 2006: Constructed in 1950 with additions in 1952-53, this 1-story, 4-bay, gableroofed, vernacular commercial building is constructed of concrete block. The roof, which has deeply overhanging eaves on the front, is clad in asphalt shingle. The southern end of the building is the oldest and contains full plate-glass windows and a corner window.

Individual Resource Status: Commercial Building Contributing Total: 1

## \*501 9<sup>th</sup> Street SW 104-0031 Other DHR Id #: 104-0213-0050



Primary Resource Information: Single Dwelling, Stories 2.00, Style: Early Classical Revival, 1822

July 2006: Constructed in 1822, this 2-story, three-part brick dwelling is an accomplished example of Jeffersonian Palladianism and was constructed by builders who worked for Jefferson on the academic village at the University of Virginia. James Dinsmore, a Scots-Irish builder who worked for Jefferson, is believed to have designed the house and also worked on its construction. The house is comprised of a 2-story, 3-bay, gable-end central brick block flanked by slightly recessed, 1-story, 2-bay brick

wings with side gable roofs. The brick walls are laid in Flemish bond above a water table of 3-course American bond with molded quarter-round bricks. The roofs are clad in

standing-seam metal. Exterior brick chimneys are located between the main block and each of the side wings. An additional interior brick chimney is located at the west end of the main block. The 1-story, 3-bay front portico with Tuscan-column supports and a plain entablature, has a flat roof with a wooden railing of turned balusters. Other details include 9/6- and 9/9-sash wood windows with louvered wooden shutters, a boxed cornice, a lunette window in the front pedimented gable-end, a 6-panel front door, two square 4-light attic windows in the west gable end, and a large glassed-in rear 1-story wing constructed in 1998. The property is listed on the National Register of Historic Places.

Individual Resource Status:	Kitchen Contri	ibuting <i>Total:</i>	1	
Individual Resource Status:	Single Dwelling	contributing	Total:	1
Individual Resource Status:	Cemetery	Contributing	Total:	1
Individual Resource Status:	Cemetery	Contributing	Total:	1
Individual Resource Status:	Shed Non-O	Contributing	Total:	1